

HO-368, Boyles Tavern
5760 Main St., Elkridge
Surveyed by: Kristin Hill
March 2003

ADDENDUM

Section 3. Owner of Property

Jesse E. and Charlotte J. Albright
1821 Fairview Avenue
Halethorpe, MD 21227

Section 4. Location of Legal Description

Howard County Courthouse
Ellicott City
Liber 2104, Folio 450 and Liber 2104, Folio 454
Tax Map 38, Parcel 593

Section 5. Primary Location of Additional Data

X Other Contributing property in the Elkridge Landing Historic Survey District, HO-784

Section 7. Description

Condition: Good, heavily altered

Date: first quarter of the nineteenth century, third quarter of the nineteenth century,
twentieth century

The structure at 5760 Main Street is recorded on the original inventory form as Boyle's Tavern dating to the early 1800's. It faces south on the northwest corner of the Main Street and Levering Avenue intersection. Kyne's Store, HO-371, is located immediately to the west. This interesting two story six bay brick structure is one of only two remaining examples of Flemish bond brickwork in Elkridge (the other being the owner's house in the Elkridge Furnace complex). Unfortunately, it has been heavily modernized and altered. Built in at least four stages, the existing structure is composed of two brick sections built side by side and two large rear frame additions. The side by side brick sections both have side gabled roofs covered with asphalt shingles but a slight difference in height yields two different rooflines. Each brick section boasts a single interior square brick chimney. The building has been divided into apartments and office space and the original detailing has been either concealed or removed.

The front façade of this building shows both the first and second building periods. The original structure is comprised of the western most two story three bay section which boasts the Flemish bond brickwork. There are two windows in the second story of this section and two windows and a door on the first story. All of the windows are 1/1 vinyl replacements. The second story windows have header brick lintels while the first story windows and door are capped with gauged flat brick arches. All of the original window sills have been replaced with modern brick. The existing door is glazed and paneled with

ADDENDUM

a transom, and while neither of these elements is original, the opening is an original door opening. The eastern most two story three bay section has 7:1 common bond brickwork on the front façade. Three windows decorate the second story while a central entry flanked by a window on each side completes the first story. All of the windows and the door opening in this portion of the building are capped by gauged flat brick arches, and, as in the original part of the building, the windows are all vinyl replacements and the sills have been replaced with modern brick. The existing door is glazed and paneled with six lights over two vertical panels, and has a four light transom. Again, though neither of these elements is original, the opening is. The existing wooden door frame seems very wide and it is possible that this entry originally had sidelights. The transition between the two sections is marked both by a change in roof height and by inconsistencies in the brickwork from ground to roof. There is no vertical seam; instead care was taken to tie the wall together with Flemish bond, but it is obvious that this is the area of transition from one building phase to another. However, although the two halves have two different rooflines and a noticeable seam, the division between the two sections isn't as clear as you would expect. The Flemish bond actually extends into the wall beneath the later additions roofline one bay. But the line of closers at the point where the Flemish bond terminates (theoretically indicating an opening or a corner) only extends halfway up the second story. There is also an obvious straight seam in the middle of the wall above the door in the later addition that defies explanation. There are no porches or entry porticos. A concrete pad covers an area in front of the building about six feet deep and runs across the full width of the building.

The western façade shows the original building and the third and fourth period frame additions. The original brick building was only one room deep and has one window on each story including one in the gable end. The windows are vertically aligned and the first story window is capped by a gauged flat brick arch. The first and second story windows are 1/1 vinyl replacements. The only possible original window remaining in the building is located in the gable end – it is double hung with 6/6 lights. The window sills on the first and second story have been replaced with modern brick and the window openings have been widened, probably to accommodate the standard sized replacement windows. Brick bond on this façade is 5:1. Two two-story frame additions, now covered with vinyl siding, were made to the rear of the original building.

The eastern façade of the building is the eastern façade of the later two story brick addition. This portion of the building is two rooms deep with a side gabled roof over the front room and a shed roof over the rear room. There are two windows in the second story and two in the first. These openings are vertically aligned and capped with flat brick arches. All of the windows are vinyl replacements and the windows sills have been replaced with modern brick. The brick bond on this façade is 7:1. The 1970's inventory form stated that the shed roofed portion of the structure was a later addition but no seam in the brick work is visible to support this claim. There is another anomaly visible on this façade at the front corner of the building: the front façade appears to be a facing. At this corner, the bricks in the front façade extend past the side wall about an inch or two and do not appear to tie into this wall. The idea of a facing or false front doesn't make a lot

ADDENDUM

of sense, however, when looking at the anomalies and inconsistencies in the front façade. If it was a false front, you would expect a smooth façade with no inconsistencies in the brick bond.

The rear (north) façade of the original portion of the building has been covered by the frame additions. One frame addition was made to the rear of the original building and another frame addition was made to the rear of the first addition. Both of these additions have front gabled roofs that are perpendicular to the roof line of the original building. The rear of the eastern brick addition has two windows on the second story and a window and a door on the first story. All of the apertures are capped by flat brick arches and the brick bond on this façade is 7:1 as it is on the other facades of this portion of the structure.


The interior of this building has been severely altered. The interior of the original brick building has been divided into apartments and the first floor of the brick addition is used for office space. Wall paneling, carpet, and drop tile ceilings conceal or replace all interior trim elements. As might be expected from the fenestration, the original building had a side hall plan and an early staircase does survive. It has a large turned newel post and turned balusters and scroll decoration on the stair ends. The basement of the original section was accessed but even it has been modernized with a concrete floor, cinderblock walls, and plywood ceiling.

This building has essentially been restored to death. In addition to the multitude of interior alterations, the exterior of the masonry has been sandblasted to remove paint and this has done major damage to the building. The hard exterior surface of the bricks has been blasted away exposing the softer fired bright orange interior to the elements. The bricks are disintegrating rapidly and in some places the brick face has disintegrated to a depth of more than half an inch. The mortar joints were also probably seriously damaged by the sandblasting and the entire building was repointed with a Portland cement based mortar with a distinctive gray cast. This mortar is too hard for the old hand-made bricks and it is causing the faces of the brick to spall off as the bricks shrink and expand with the seasons.

There is virtually no evidence left to date this building but the presence of the Flemish bond on the earliest portion indicates a date of no later than the first quarter of the nineteenth century for that section. The section with 7:1 common bond probably dates to no earlier than 1850 but could be as late as the 1870's.

Section 11. Form Prepared by

Kristin H. Hill, Architectural Historian
Howard County Department of Planning and Zoning
3430 Court House Drive
Ellicott City, MD 21043
410-313-4335
February 2003

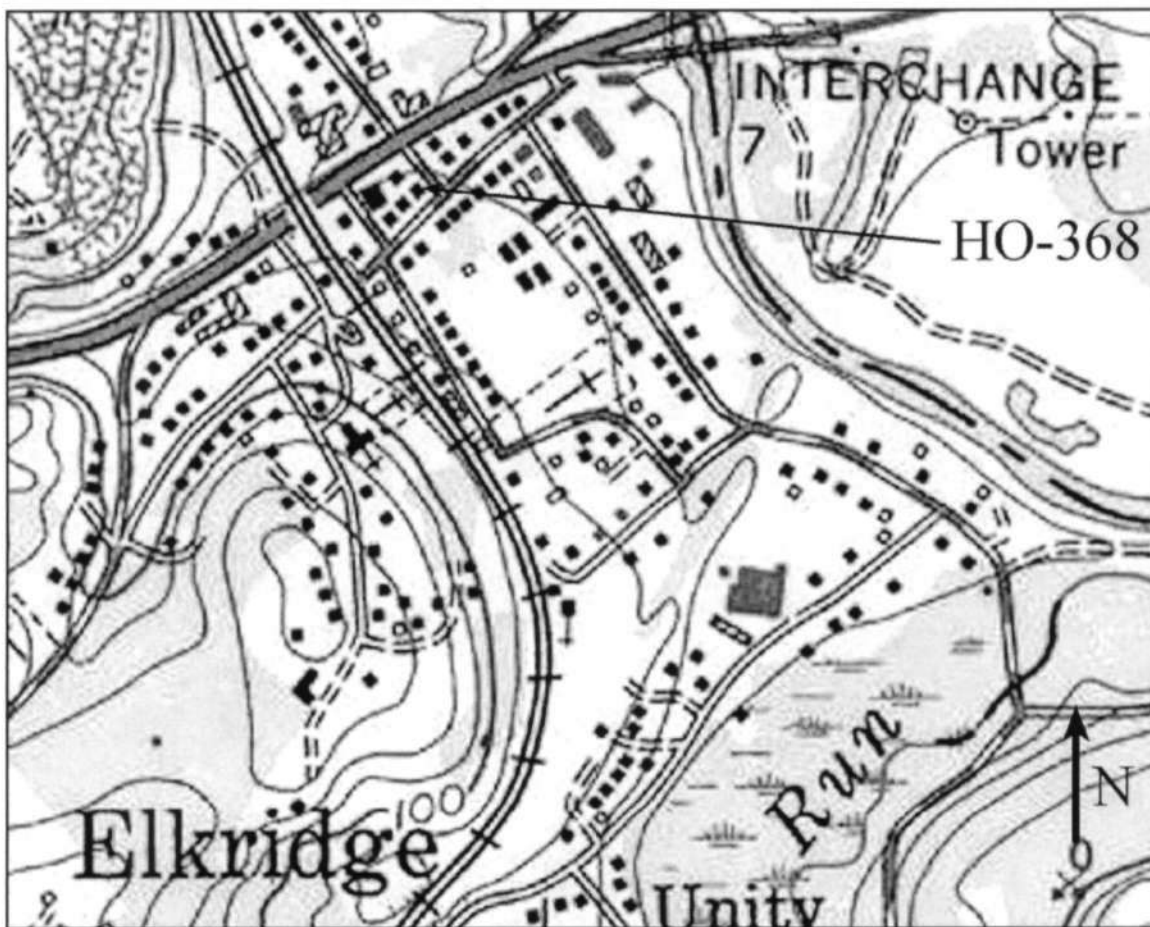

HO-368, Boyle's Tavern
Elkridge, Howard County, MD
USGS Topographic Quadrangle, Relay
7.5 Minute Series, 1957 (PR 1966 and 1974)



HO-368 Boyles Tavern
5760 Main St., Elkridge Landing Historic District
Howard County, MD

13 21+00 NNNNN 688

Kristin Hill, 3/03
Negative at MD SHPO
SW elevation
1 of 4



HO-368 Boyles Tavern

5760 Main St., Elkridge Landing Historic District

Howard County, MD

Kristin Hill, 3/03

Negative at MD SHPO

South elevation

14 21+00 NNNNN 688

2 of 4



HO-368 Bayles Tavern
5760 main st., Elkridge Landing Historic District

Howard County, MD

Kristin Hill, 3/03

Negative at MD SH80

Original entry showing flat arches and replacement
window sill.

3 of 4

21+00 NHHH-688
NHHH-688
00+12



HO-368 Boyles Tavern
5760 Main Street, Elkridge Landing Historic District

Howard County, MD

16 21-01 NNNNN 688

Kristin Hill, 3/03

Negative at MD SHPO

NE elevation

4 of 4

HO-368
BOYLE'S TAVERN
Elkridge
Private

early eighteen hundreds

Formerly Boyle's Tavern and the old O'Malley home, a political figure in the affairs of Elkridge, this structure is composed of two dwellings or a north and south wing, each two stories high with their east walls (laid in flemish bond). The building is characterized by rectangular east entrances surmounted by four lite transoms, stretcher brick flat arched lintels decorating doors and proportionally scaled double-hung windows and gabled roofs running north-south which set into one another with brick chimneys resting in their west walls which have original additions.

MARYLAND HISTORICAL TRUST WORKSHEET

NOMINATION FORM
for the
NATIONAL REGISTER OF HISTORIC PLACES, NATIONAL PARKS SERVICE

SEE INSTRUCTIONS

1. NAME					
COMMON: Boyle's Tavern					
AND/OR HISTORIC: O'Malley Home (1878), Boyle's Tavern					
2. LOCATION					
STREET AND NUMBER: 5760 Main Street					
CITY OR TOWN: Elkridge					
STATE Maryland			COUNTY: Howard		
3. CLASSIFICATION					
CATEGORY (Check One)		OWNERSHIP		STATUS	
<input checked="" type="checkbox"/> District <input type="checkbox"/> Building <input type="checkbox"/> Site <input type="checkbox"/> Structure <input type="checkbox"/> Object		<input type="checkbox"/> Public <input checked="" type="checkbox"/> Private <input type="checkbox"/> Both		<input checked="" type="checkbox"/> Occupied <input type="checkbox"/> Unoccupied <input type="checkbox"/> Preservation work in progress	
		Public Acquisition: <input type="checkbox"/> In Process <input type="checkbox"/> Being Considered		ACCESSIBLE TO THE PUBLIC Yes: <input checked="" type="checkbox"/> Restricted <input type="checkbox"/> Unrestricted <input type="checkbox"/> No	
PRESENT USE (Check One or More as Appropriate)					
<input type="checkbox"/> Agricultural <input type="checkbox"/> Commercial <input type="checkbox"/> Educational <input type="checkbox"/> Entertainment		<input type="checkbox"/> Government <input type="checkbox"/> Industrial <input type="checkbox"/> Military <input type="checkbox"/> Museum		<input type="checkbox"/> Park <input checked="" type="checkbox"/> Private Residence <input type="checkbox"/> Religious <input type="checkbox"/> Scientific	
		<input type="checkbox"/> Transportation <input checked="" type="checkbox"/> Other (Specify) Office		<input type="checkbox"/> Comments	
4. OWNER OF PROPERTY					
OWNER'S NAME: Thomas E. & Philip W. Kyne					
STREET AND NUMBER: 5760 Main Street					
CITY OR TOWN: Elkridge			STATE: Maryland		21227
5. LOCATION OF LEGAL DESCRIPTION					
COURTHOUSE, REGISTRY OF DEEDS, ETC: Hall of Records					
STREET AND NUMBER: Howard County Court House					
CITY OR TOWN: Ellicott City			STATE: Maryland		21043
Title Reference of Current Deed (Book & Pg. #): Tax Map 38, Blk 4					
/p 593 522-174					
6. REPRESENTATION IN EXISTING SURVEYS					
TITLE OF SURVEY: Howard County Historic Sites Inventory					
DATE OF SURVEY: 1976 <input type="checkbox"/> Federal <input checked="" type="checkbox"/> State <input type="checkbox"/> County <input type="checkbox"/> Local					
DEPOSITORY FOR SURVEY RECORDS: Maryland Historical Trust					
STREET AND NUMBER: 21 State Circle					
CITY OR TOWN: Annapolia			STATE: Maryland		21401

HO-368

7. DESCRIPTION

CONDITION	(Check One)					
	<input checked="" type="checkbox"/> Excellent	<input type="checkbox"/> Good	<input type="checkbox"/> Fair	<input type="checkbox"/> Deteriorated	<input type="checkbox"/> Ruins	<input type="checkbox"/> Unexposed
	(Check One)			(Check One)		
	<input type="checkbox"/> Altered	<input checked="" type="checkbox"/> Unaltered	<input type="checkbox"/> Moved	<input checked="" type="checkbox"/> Original Site		

DESCRIBE THE PRESENT AND ORIGINAL (if known) PHYSICAL APPEARANCE

5760 Main Street is located on the southwest corner of Main Street and Levering Avenue. Formerly, Mrs. Boyle's Tavern and the Old O'Malley Home.

This structure is composed of two dwellings or a north and south wing. The north wing is a two story brick (laid in English garden wall bond) structure three bays wide and two bays deep with a gable roof running north-south. A central rectangular door faces east and is surmounted by a four lite transom. Windows are proportionally scaled, double-hung holding six-over-six lites. Stretcher brick flat arched lintels decorate the doors and windows of the building. A brick chimney is laid into the west wall of the north corner of the original structure.

The north elevation reveals that this building was at one time one bay deep and very early had a shed roof addition of two stories, one bay wide and two bays deep added to the west wall. The brick has been laid very carefully and continuously so that it is difficult to access the differing periods of construction. Two first and second floor windows are decorated by flat arched brick lintels and flat wooden sills.

The west elevation is four bays wide, two bays of which belong to the shed roof addition and are of brick with windows similar to those on the east and north elevations. An entrance door is located on the second south bay.

In all probability the south wing of the house was the original dwelling as the second floor windows are decorated with header brick lintels similar to those found at Pleasant Valley on Forsythe Road, and generally representative of older houses. The first floor windows are proportionally scaled and have stretcher brick flat arched lintels, with wooden projecting sills and double-hung sashes holding six-over-six lites.

The east facade of the house is laid in Flemish bond brick, an early practice of the builders of Howard County wishing to enhance the main entrance of the building. This is seen at Rockburn and on the Old Brick House on the Pike as well as others.

The south elevation of the house is laid in English garden wall brick bond. Its first floor window is centered into the south wall, decorated with a flat arched brick lintel while the proportionally scaled second floor window above has a header brick flat lintel. A third story window set into the gable end of the roof also has a header brick lintel.

A brick chimney is set into the west wall of the original brick structure on the south corner of the steep gable roof which is inset into the steeply pitched gable roof of the north wing.

A two story, two bay deep frame addition on the west wall of the north wing has a first floor rectangular window with six-over-six lites on the north wall and a double rectangular window, each composed of six-over-six lights on the second floor.

A further appendage two stones high, two bays wide and one deep with gabled roof is located on the west wall of the first frame addition. The windows on the north wall are rectangular with eight-over-eight lites. The east elevation has an entrance with shed roof and a second floor double-hung window with six-over-six lites.

SEE INSTRUCTIONS

HO-368

8. SIGNIFICANCE

PERIOD (Check One or More as Appropriate)

- | | | | |
|--|---------------------------------------|--|---------------------------------------|
| <input type="checkbox"/> Pre-Columbian | <input type="checkbox"/> 16th Century | <input checked="" type="checkbox"/> 18th Century | <input type="checkbox"/> 20th Century |
| <input type="checkbox"/> 15th Century | <input type="checkbox"/> 17th Century | <input checked="" type="checkbox"/> 19th Century | |

SPECIFIC DATE(S) (If Applicable and Known)

AREAS OF SIGNIFICANCE (Check One or More as Appropriate)

- | | | | |
|--|--------------------------------------|---|--|
| <input type="checkbox"/> Aboriginal | <input type="checkbox"/> Education | <input type="checkbox"/> Political | <input type="checkbox"/> Urban Planning |
| <input type="checkbox"/> Prehistoric | <input type="checkbox"/> Engineering | <input type="checkbox"/> Religion/Phi- | <input type="checkbox"/> Other (Specify) |
| <input checked="" type="checkbox"/> Historic | <input type="checkbox"/> Industry | losophy | _____ |
| <input type="checkbox"/> Agriculture | <input type="checkbox"/> Invention | <input type="checkbox"/> Science | _____ |
| <input checked="" type="checkbox"/> Architecture | <input type="checkbox"/> Landscape | <input type="checkbox"/> Sculpture | _____ |
| <input type="checkbox"/> Art | Architecture | <input type="checkbox"/> Social/Human- | _____ |
| <input type="checkbox"/> Commerce | <input type="checkbox"/> Literature | itarian | _____ |
| <input type="checkbox"/> Communications | <input type="checkbox"/> Military | <input type="checkbox"/> Theater | _____ |
| <input type="checkbox"/> Conservation | <input type="checkbox"/> Music | <input type="checkbox"/> Transportation | _____ |

STATEMENT OF SIGNIFICANCE

Boyle's Tavern is significant historically and architecturally.

When the Mason-Dixon line was drawn up, those concerned wanted to go down to Annapolis and sign it. Heavy rains caused the bridge to flood so that the gentlemen retired to Boyle's Tavern and signed it there.

Architecturally it stands as an example of a federal building with fine proportions.

As a part of the composite which is Main Street, ElkrIDGE, Boyle's Tavern is important as it provides an architectural and historical anchor to the whole.

SEE INSTRUCTIONS

HO-368

9. MAJOR BIBLIOGRAPHICAL REFERENCES

Interview with Misses Annie C. & Elizabeth Kyne, 5762 Main Street, Elkridge, Maryland, sisters of owner. July 14, 1976.

10. GEOGRAPHICAL DATA

LATITUDE AND LONGITUDE COORDINATES DEFINING A RECTANGLE LOCATING THE PROPERTY					O R	LATITUDE AND LONGITUDE COORDINATES DEFINING THE CENTER POINT OF A PROPERTY OF LESS THAN TEN ACRES				
CORNER	LATITUDE			LONGITUDE		LATITUDE			LONGITUDE	
	Degrees	Minutes	Seconds	Degrees		Minutes	Seconds	Degrees	Minutes	Seconds
NW	°	'	"	°		'	"	°	'	"
NE	°	'	"	°		'	"	°	'	"
SE	°	'	"	°	'	"	°	'	"	
SW	°	'	"	°	'	"	°	'	"	

APPROXIMATE ACREAGE OF NOMINATED PROPERTY:

Acreage Justification:

.145 Acres & Imp

Please see Tax Map 38, Blk 4 p. 593 522-174

11. FORM PREPARED BY

NAME AND TITLE: Cleora Barnes Thompson, Archivist		
ORGANIZATION Office of Planning & Zoning - Comprehensive Planning Section	DATE	
STREET AND NUMBER: 3450 Court House Drive		
CITY OR TOWN: Ellicott City	STATE Maryland	21043

12. State Liaison Officer Review: (Office Use Only)


Significance of this property is:


National ☐ State ☐ Local ☐

Signature _____

SEE INSTRUCTIONS

HO-368

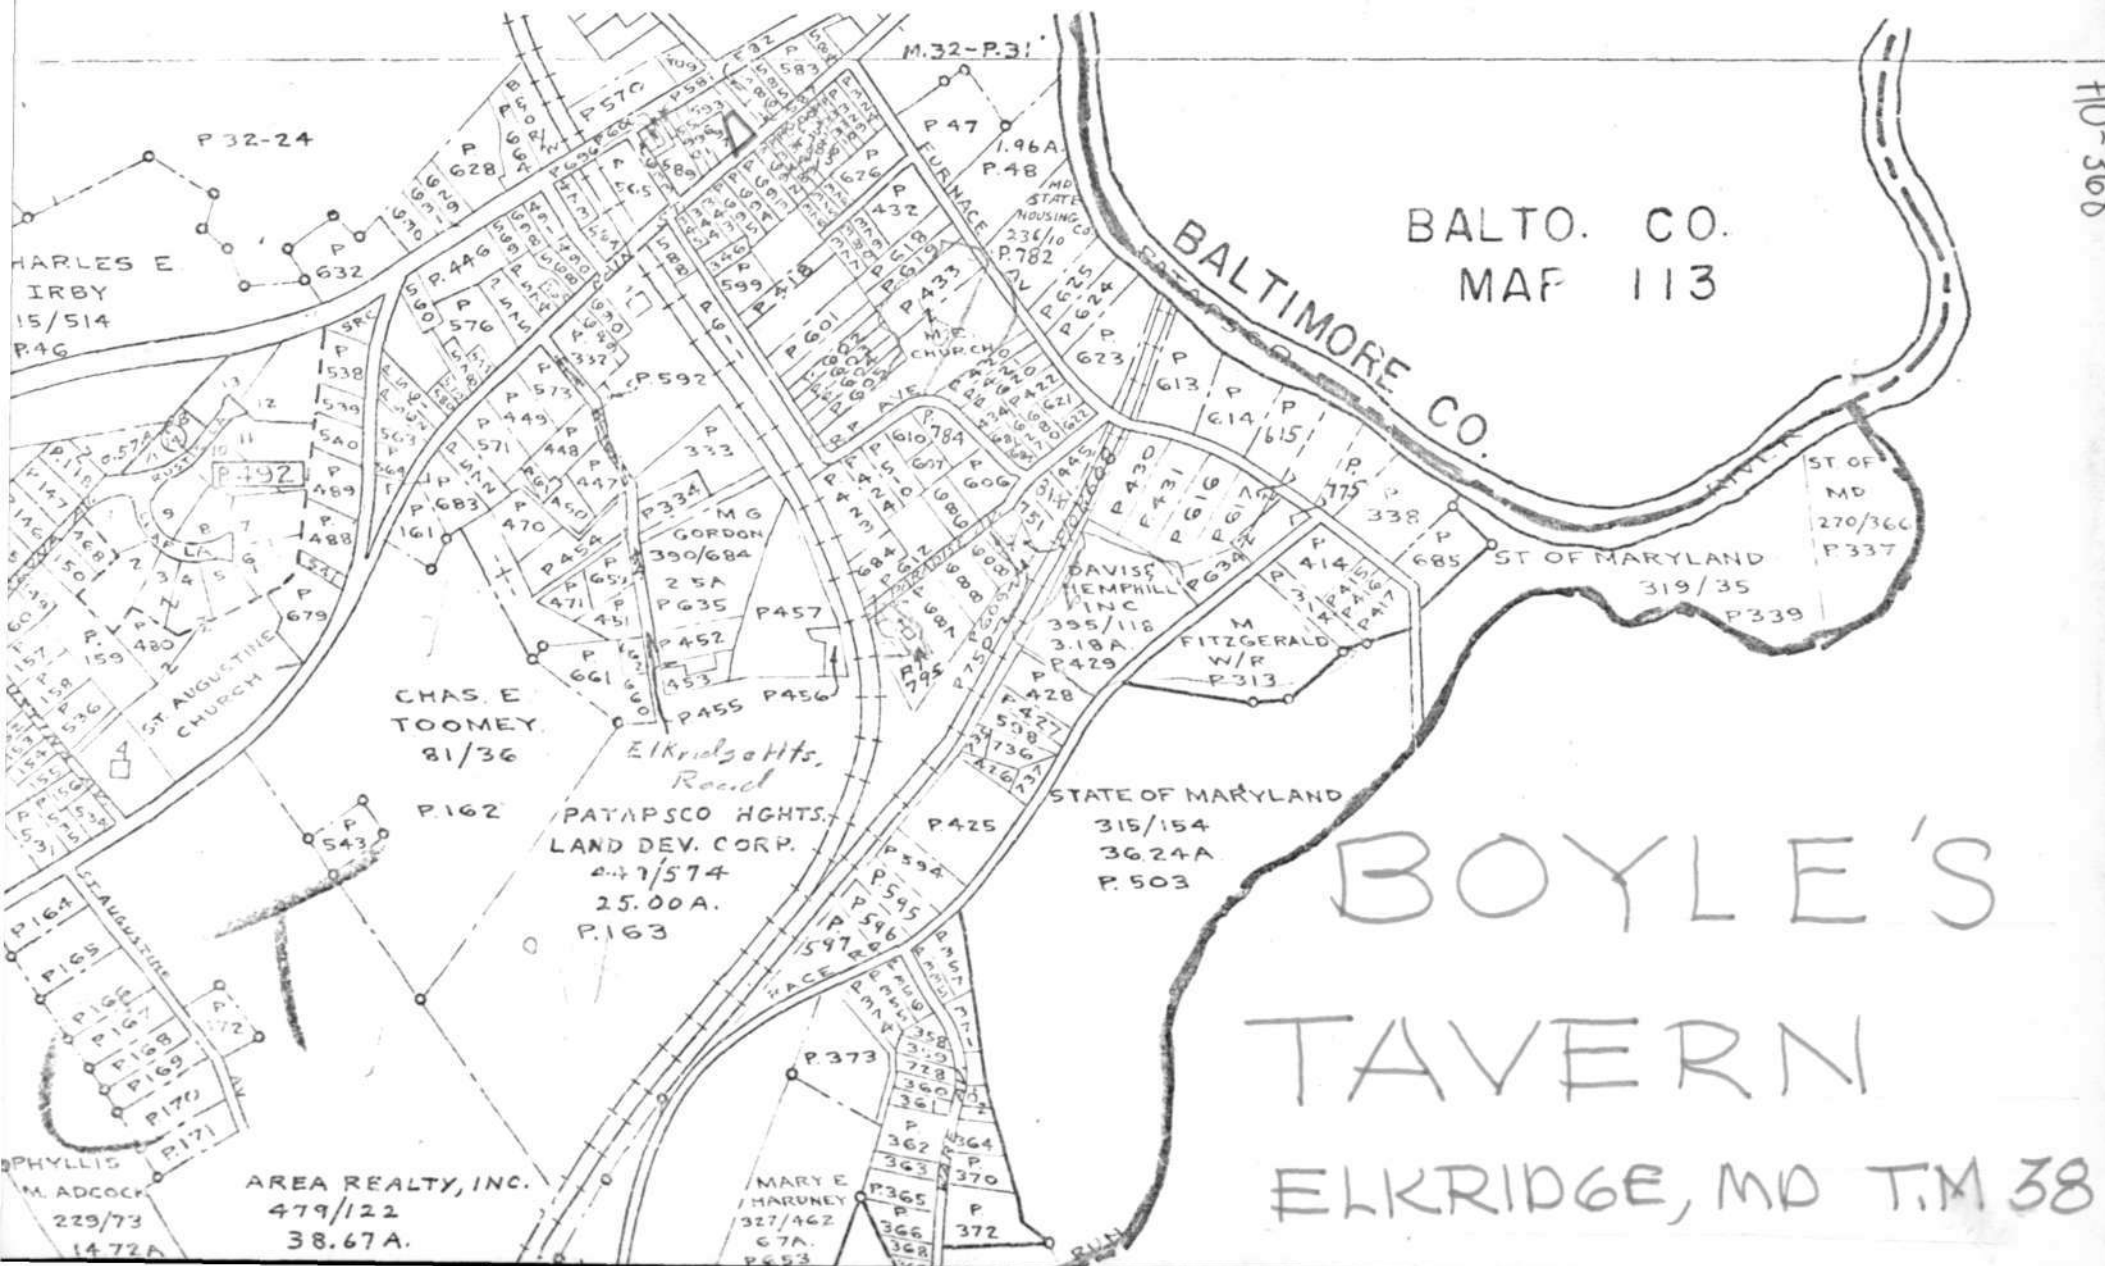

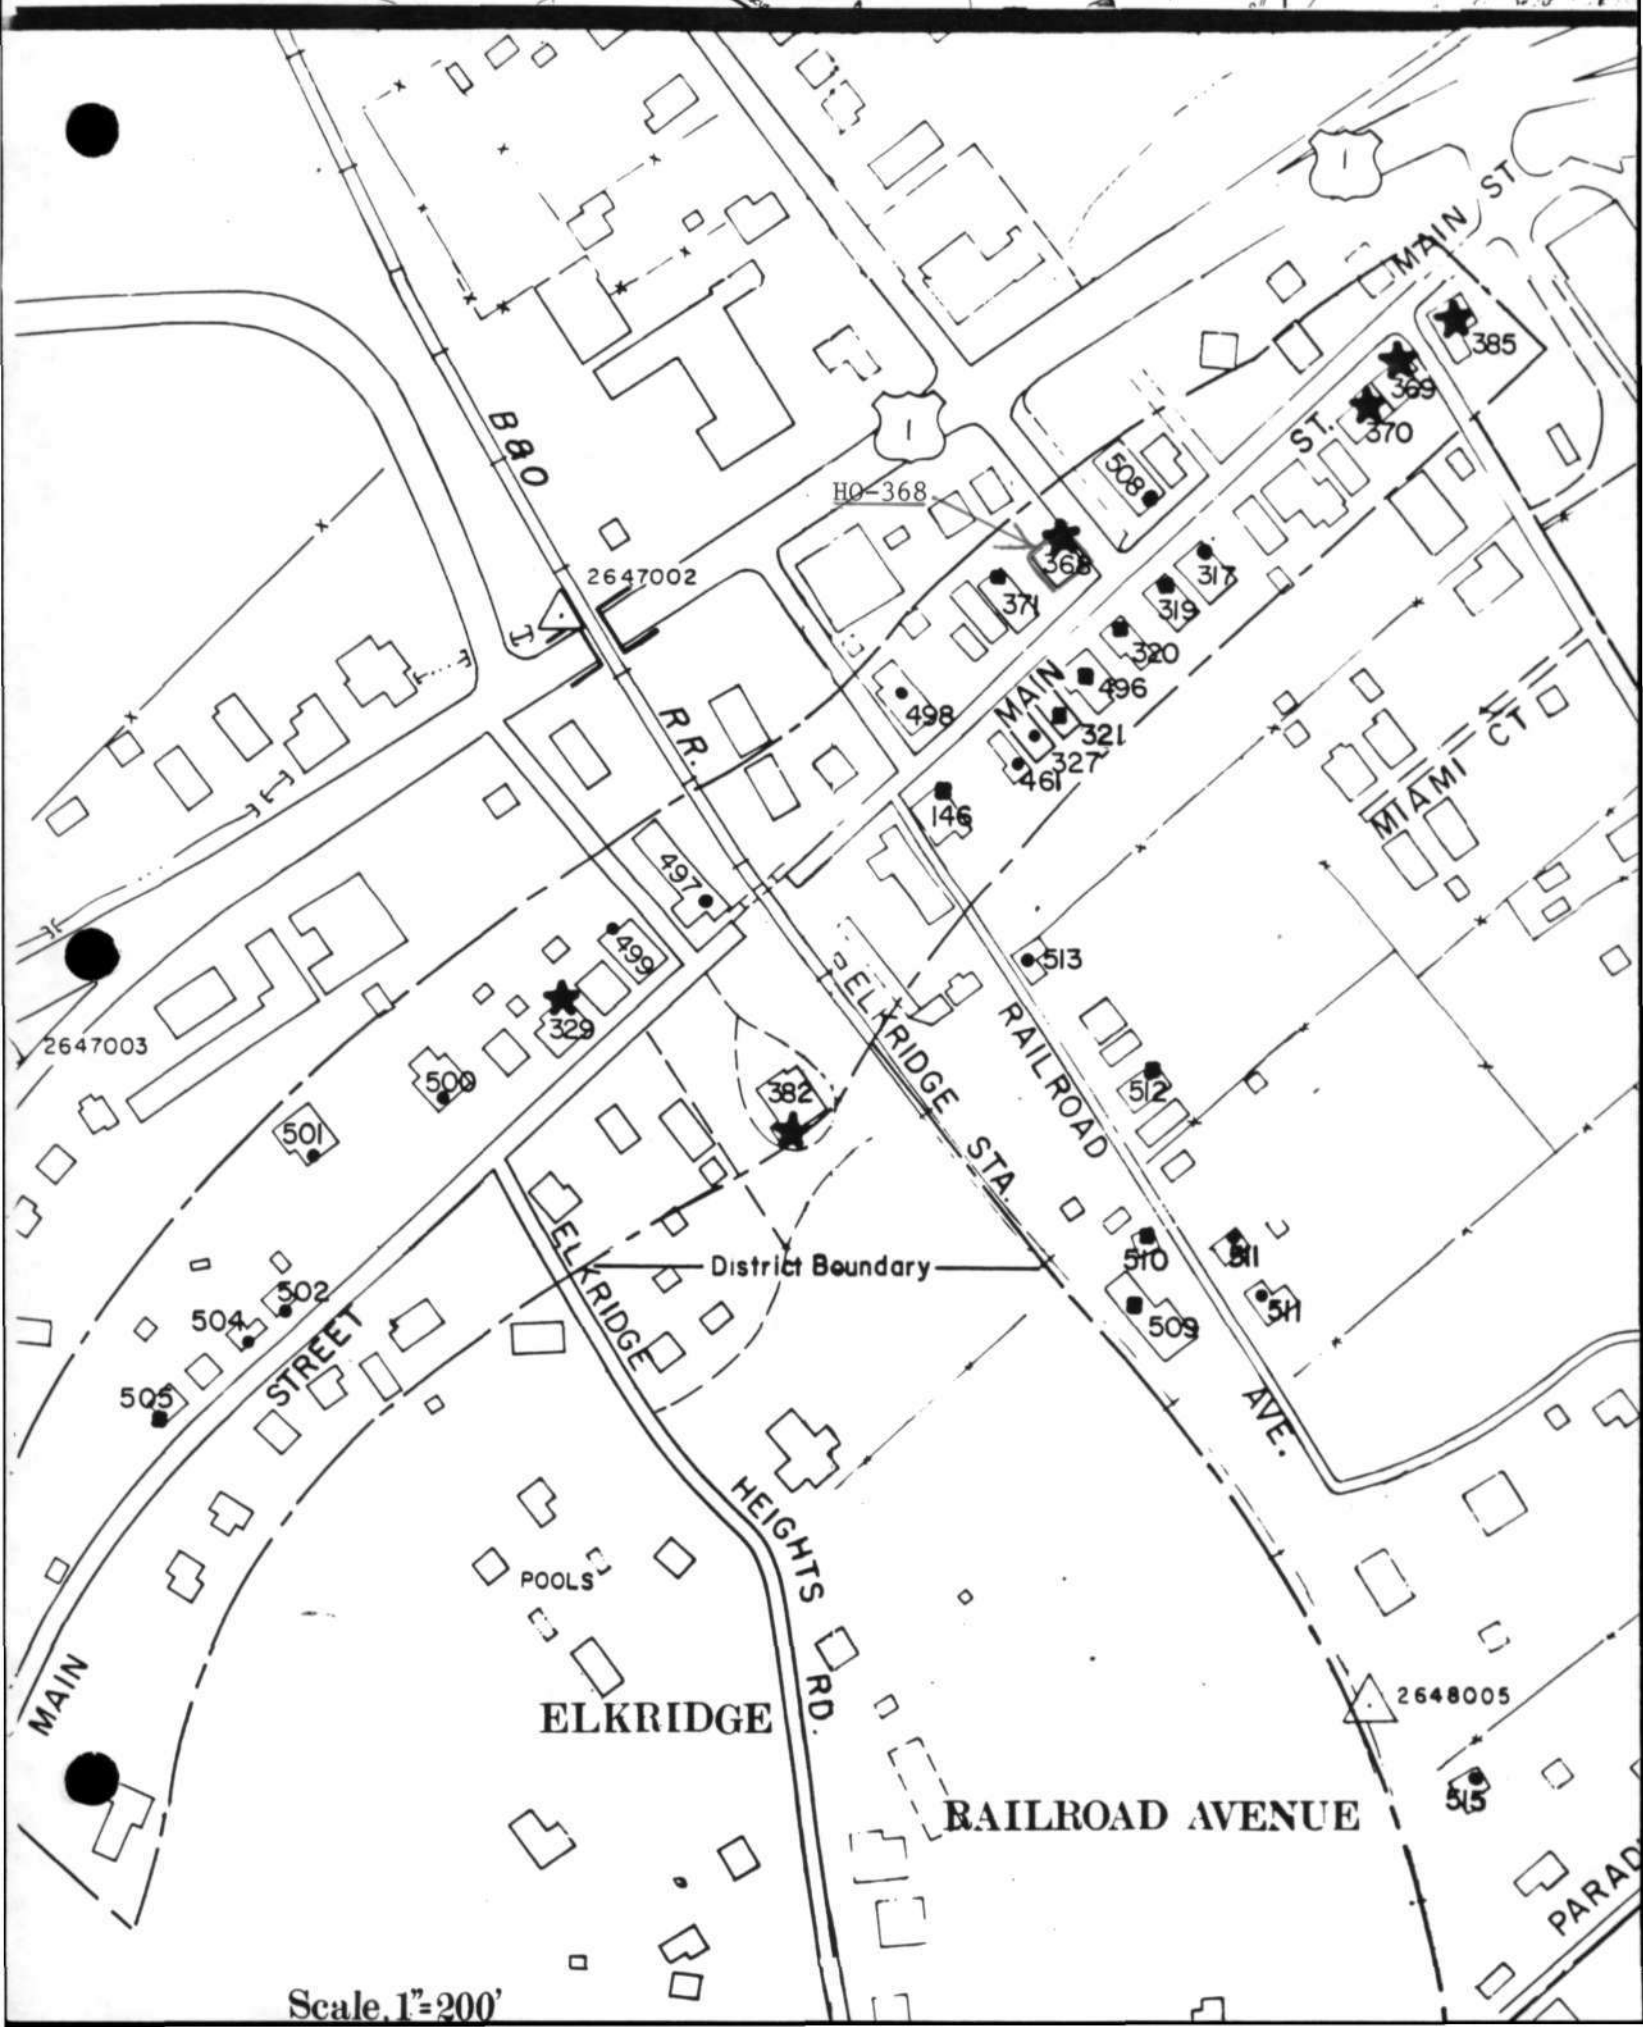



RD-368
Boyle's Tavern (O'Nalley Home)
5760 Main Street, Elkridge
Relay Quad, 1957, PR 1956 & 1974



HO-368 DIST 1
BOYLE'S TAVERN

CLEORA K. H. THOMPSON
PLANNING CONSULTANT
HISTORICAL SITES SURVEY